



TECHNICAL SERVICE BULLETIN



TSB-D-GN-VR-0031

Date: July 11, 2023
To: Internal, Sales, Distribution, and Sales Representatives
From: Technical Services Department
Subject: **New Wiring Harness Adapters for KRP1C74 and KRP1C75 Wiring Adapter PCB**

It has come to our attention that there has been a design change to the X33A plug connection, in certain fan coils, creating an incompatibility with the current KRP1C74 and KRP1C75 wiring adapter PCBs.

Models Affected				
FXSQ_TBVJU	FXMQ_TBVJU	FXZQ_TBVJU	FBQ_TBVJU	FCQ_AAVJU

To make a proper connection, select the appropriate new wiring harness from the list below. New wiring harnesses can be ordered immediately through Daikin Spare Parts.

Compatibility and Pairing Chart

Wiring Adapter PCB	KRP1C74	KRP1C75
Indoor Unit Models	FXSQ_TBVJU	FXZQ_TBVJU
	FXMQ_TBVJU	FCQ_AAVJU
	FBQ_TBVJU	-----
New Wiring Harness	4P527084-1	4P416114-5

To Install:

Remove the standard wiring harness that shipped with the Wiring Adapter PCB, replace this wiring harness with the new wiring harness (4P527084-1 or 4P416114-5) by referring to the Compatibility and Pairing Chart above and make the connection to the X33A on the indoor unit PCB.

If you have technical questions, please call 1-855-DAIKIN1, option 4, or e-mail TechnicalServicesDaikin@daikincomfort.com.

Note: This Sales Bulletin constitutes "Confidential Information" as defined in, and is subject to the terms of, your Distributor Sales Agreement.

DAIKIN COMFORT TECHNOLOGIES NORTH AMERICA, INC.

19001 Kermier Road • Waller, TX 77484 • (713) 861-2500 • www.northamerica-daikin.com